





## 518 W. Montgomery Street Henderson, NC 27536. Phone:(252)492-7541 Fax: (252) 431-1934 Serving Industry Since 1952

8/3/2022

|   |  |  | <u>. F</u>   | <u>Repair Quote</u>  | <u>)</u>  | Sales  | sman  | Danny   |
|---|--|--|--|--|---|--|---|---|
| <u>Our</u>                              | S.O. No:   | 141310   |  | Go Ah  | ead No  | Fax / Email  | Date  | 8/26/22   |
| o: C                                    | ustomer:   | Durham Cou   | ınty Utility Div.  | Triangle WW  | /TP   |  |   |   |
|   | ATTN:  | Wade Shaw  |  |  | Customer I  | P.O. No. FR2   | 2-742   |   |
|   | Fax No:  | 919-544-8590   |  | Custom   | ner Ref. No.  |  |   |   |
|   | E-mail :   | wshaw@dcond  | c.gov  | Cust   | tomer Data  |  |   |   |
|   |  | <u>.</u>   | Concerning R   | epairs To Yo   | our Equip   | <u>ment</u>  |   |   |
| Manu                                    | ıfacturer Da   | vis EMU  |  | <b>H.P.</b> 2.70   | RPM   | 1140   | Mou   | nt Asy Special  |
| M                                       | Lodel No Da  | te CE 2004   |  | K.W.   | Frame   |  | _<br>A.C  | :.Volts 460   |
|   | Type T1  |  |  |  |   |  | A.C   | Amps 4.75   |
| s                                       | Serial No 30   |  | As   | ssoc. Conn. Ed   | <b>quip</b> . TR50-2  | 2.37-6/8   |   |   |
|   | Phase 3  |  |  | Mixer  | $\neg$  |  |   |   |
| ppli                                    | cation Mix   | er   |  | -  |   |  |   |   |
| _                                       | Work Need  | ded:   |  |  |   |  |   |   |
| w                                       | ere damage   | ed and the cord t  | It was also found rumpet was broke   | that the cord, e<br>en.  |   |  |   | and planetary gears   |
| W<br>R<br>ar<br>se<br>w<br>fu<br>m      | ere damage<br>epairs will in<br>nd housing<br>eal surfaces<br>ith 10m core<br>irnish and ir<br>arine black   | ed and the cord the c | It was also found rumpet was broken ble, sandblast/cleake out stator, install new factory pair kit, consisting o   | that the cord, een. ean and inspect spect and surge arts, new seal w f; mechanical se ord trumpet, re-                   | t parts, inspe<br>test winding<br>asher, new p<br>eals, bearing<br>assemble, re | ct for wear an<br>, hi-pot test, b<br>planetary gear<br>s, lip seals, o-<br>eplace oil, test               | d meas<br>uild up<br>set, ne                      | sure bearing shaft  |
| W<br>R<br>ar<br>se<br>W<br>fu<br>m<br>C | ere damage<br>epairs will in<br>d housing<br>eal surfaces<br>ith 10m core<br>irnish and in<br>arine black<br>Delivery on the<br>hank you,<br>acob Reed | ed and the cord the c | It was also found rumpet was broken mble, sandblast/cleake out stator, install new factory pair kit, consisting ocord and re-pot consisting of the cord and re-pot consisting of | that the cord, een. ean and inspect spect and surge arts, new seal w f; mechanical se ord trumpet, re- s due to lead tim | t parts, inspertest winding rasher, new peals, bearing assemble, re             | ct for wear an<br>, hi-pot test, b<br>planetary gear<br>s, lip seals, o-<br>eplace oil, test<br>ory parts. | d meas<br>uild up<br>set, ne<br>rings a<br>run an | sure bearing shaft<br>and machine (2)<br>ew pencil electrode<br>and misc. hardware,<br>nd paint with 2-part |

The above prices are valid for 30 days and do not include freight or any necessary taxes.

Please Let Us Know As Soon As Possible Whether You Would Rather Repair Or Replace. After 90 days of being quoted, this job may be returned not repaired if not approved. Fax Us At (252)-431-1934 Or Telephone Us At 800-232-7541