





## 518 W. Montgomery Street Henderson, NC 27536. Phone:(252)492-7541 Fax: (252) 431-1934 Serving Industry Since 1952

9/21/2022

			<u>Repair</u>	<b>Quote</b>		Salesman Danny
<u>Our</u>	S.O. No:	141716		Go Ahead	No	Fax / Email Date 10/20/22
To: Customer: Durham County Utility Div. Triangle WWTP						
	ATTN:	Wade Shaw		Cus	stomer	P.O. No. FR22-742
	Fax No:	919-544-8590		Customer F	Ref. No.	Tag#00569, EQ Basin
	E-mail :	wshaw@dconc.gov		Custome	r Data	Landia Blower, Aerator#2, Landia DG-I,
Concerning Repairs To Your Equipment						
Manu	facturer Lar	ndia	H.P	12.2	] RPM	1750 Mount Asy Special
M	odel No Yr.	2012	K.W		Frame	A.C.Volts 460/796
	Type DG					A.C Amps 15.5/-
S	erial No 276		Assoc. C	onn. Equip.	Start U	Up: 93.0 Amps.
	Phase 3					
Applic	cation Aer	ator				
	Work Need	ed:				
The below mixer was disassembled and inspected and it was determined that the cause of failure was due to the						
mechanical seal failing as well as the impeller and knives.						
The repair of the below will include:						
Disassemble, clean, steam clean and bake stator with winding, inspect and surge test winding, hi-pot test, measure						
shaft and housing bearing and seal surfaces, build up and machine pulley surface, bush and machine drive end endbell, build up and machine (2) seal surfaces, balance rotor, furnish and install (2) new mechanical seals, (1) new						
impeller, new knives with stationary knives, new o-rings, new stainless steel washers, (35') 10/10 Power cord, pour						
cord cap, reassemble, replace oil and test-run.						
I am also quoting a new replacement :						
(1) Landia aerator mixer, Type#DG-I, 12.2HP, 3-phase, 60 Cycles, 1800 RPM, 460 Volts.						
(6-8 Weeks Delivery ARO).						
Thank you.						
	·					
St	nawn Gillesp	pie				
We have disassembled this machine, measured all bearing surfaces(shafts and endbells)for wear,						
recorded all bearing information, tested all windings for possible faults using BakerSurge Tester.						
Our labor cost involved so far in this determination is \$ 360.00						
Above evaluation/inspection charges will be waived if this unit is repaired / replaced.						
	Your c	ost New Replacement				Total Repair Costs
\$ 18,890.00 \$ 10,976.70						\$ 1 <mark>0,976.70</mark>
	•					
					N .	

The above prices are valid for 30 days and do not include freight or any necessary taxes. Please Let Us Know As Soon As Possible Whether You Would Rather Repair Or Replace. After 90 days of being quoted, this job may be returned not repaired if not approved. Fax Us At (252)-431-1934 Or Telephone Us At 800-232-7541