| I | PACCREDITED. | |
|---|----------------------------------|--------------------------------------|
| 2 | | |
| | EASA AR100 Hollond Industrial | |
| 518 W. Montgomery Street Henderson, NC 27536. Phone:(252)492-7541 Fax: (252) 431-1934 | | |
| INDUSTRIAL | Serving Industry Since 1952 | 9/21/2022 |
| | Repair Quote | Salesman Danny |
| <u>Our</u> S.O. No: 141718 | Go Ahead No F | Fax / Email Date 11/4/22 |
| To: Customer: Durham County Utility | | |
| ATTN: David Futrell | | 0. No. FR22-742 |
| Fax No: 919-544-8590 | Customer Ref. No.Ta | |
| E-mail : davidfutrell@dconc.gov | Customer Data TR | |
| | ng Repairs To Your Equipme | <u> </u> |
| Manufacturer Davis EMU | H.P. 6 RPM 114 | |
| Model No Date CE 2004 | K.W. Frame | A.C.Volts <u>460</u> A.C Amps 9.7 |
| Type T17-6/16R | Assoc. Conn. Equip. TR75-2.1 | |
| Serial No 304338 | | |
| Phase 3 | Mixer | |
| Application Mixer Work Needed: | | |
| The below mixer was disassembled and inspected and it was determined that the cause of failure was due to the | | |
| bearings and seals wearing. The propeller was also broke on the end of one blade and will have to be replaced. | | |
| The repair of the below will include: Disassemble,clean, steam clean and bake stator with winding, inspect and surge test winding, hi-pot test, measure | | |
| shaft and housing bearing fits, furnish and install new bearings, (1) new inner and outer mechanical seal, new | | |
| o-rings, new oil seals, (1) new moisture sensor,(1) new guard ring, (1) new propeller, (50') 14/7 power cord, pour | | |
| cord cap, reassemble, replace oil, epoxy paint and test-run. (6-8 Weeks Delivery ARO due to parts). | | |
| | | |
| Thank you for the opportunity to quote the above repair. | | |
| | | |
| | | |
| Shawn Gillespie | | |
| | | |
| We have disassembled this machine, m | | |
| recorded all bearing information, tested all windings for possible faults using BakerSurge Tester. Our labor cost involved so far in this determination is \$ 420.00 | | |
| Above evaluation/inspection charges will be waived if this unit is repaired / replaced. | | |
| | ALL PAOL | |
| Your cost New Replacement | | Total Repair Costs |
| \$ 11,632.50 | | \$8,978.00 |
| | 1 Charles | |
| The above prices are valid for 30 days and do not include freight or any necessary taxes. Please Let Us Know As Soon As Possible Whether You Would Rather Repair Or Replace. | | |

The above prices are valid for 30 days and do not include freight or any necessary taxes. Please Let Us Know As Soon As Possible Whether You Would Rather Repair Or Replace. After 90 days of being quoted, this job may be returned not repaired if not approved. Fax Us At (252)-431-1934 Or Telephone Us At 800-232-7541

Attn:Patrick,Kristy,Shawn, Jacob Holland Industrial Is An Employee Owned Company (ESOP) Serving Industry Since 1952